
Radon Measurement Survey Report

Site:

Krug Elementary School
240 Melrose Avenue
Aurora, Illinois 60505

Survey Dates: May 1, 2018 thru May 3, 2018



Prepared For:

East Aurora School District 131
417 Fifth Street
Aurora, Illinois 60505

Carnow Conibear Project No. A146000137



Radon Measurement Survey Report

Site:

**Krug Elementary School
240 Melrose Avenue
Aurora, Illinois 60505**

Surveyed by:

A handwritten signature in black ink that reads "Nicole Bennett". The signature is written in a cursive style with a horizontal line underneath it.

Nicole Bennett
Radon Measurement Professional

Report by:

A handwritten signature in black ink that reads "Nicole Bennett". The signature is written in a cursive style with a horizontal line underneath it.

Nicole Bennett
Radon Measurement Professional

Reviewed by:

A handwritten signature in blue ink that reads "Derek Lantry". The signature is written in a cursive style with a horizontal line underneath it.

Derek Lantry
Director, Technical Services

Report Issued: July 3, 2018

TABLE OF CONTENTS

1.0	EXECUTIVE SUMMARY	1
2.0	BACKGROUND.....	2
3.0	SCOPE OF WORK.....	3
4.0	METHODOLOGY	4
5.0	SUMMARY OF RESULTS.....	5
6.0	CONCLUSIONS.....	9
7.0	LIMITATIONS AND CONDITIONS	10

APPENDICES

- Appendix A Floor Plans – Radon Sampling Locations
- Appendix B Laboratory Analysis Report
- Appendix C Radon Measurement Professional License

1.0 EXECUTIVE SUMMARY

Carnow, Conibear, & Assoc., Ltd. (Carnow Conibear) was contracted by East Aurora School District 131 to perform a radon measurement survey at the Krug Elementary School located at 240 Melrose Avenue in Aurora, Illinois. The survey was initiated on May 1, 2018 and completed on May 3, 2018 by Nicole Bennett, an Illinois Emergency Management Agency (IEMA) licensed Radon Measurement Professional (License No. RNI2016213). The scope of work included short-term (two to four day) radon measurements in frequently occupied rooms with substantial ground contact. The radon sampling was performed following IEMA and the United States Environmental Protection Agency (USEPA) testing protocols for commercial and school radon measurements, the radon device manufacturer's recommendations, and Carnow Conibear's Quality Assurance Plan.

A total of fifty-two (52) radon test devices were deployed including forty-five (45) single devices, four (4) duplicates, and three (3) blanks. Activated radon charcoal devices manufactured by Air Chek Inc. were utilized during the radon survey. The activated charcoal devices are passive devices containing activated carbon to measure radon. Testing was initiated on May 1, 2018 and completed on May 3, 2018.

Radon measurement results ranged from 1.8 to 7.3 PicoCuries per liter (pCi/L). The radon measurement results indicate areas tested exceeded the EPA recommended radon action level of 4.0 pCi/L during the time of the test. The average indoor radon concentrations are 1.3 pCi/L nationwide. The average outdoor radon concentration is 0.4 pCi/L.

Based on the radon measurement results Carnow Conibear recommends:

- Follow-up radon testing in locations exceeding the EPA and IEMA recommended action level of 4.0 pCi/L. Per IEMA, a recommendation to mitigate elevated levels of radon shall not be based on initial measurement results.
- Routine follow-up radon measurement surveys every two (2) years at different seasonal times following IEMA and the USEPA testing protocols and the radon device manufacturer's recommendations.
- Additional testing if significant changes are made to the building's structural or mechanical components.

2.0 BACKGROUND

Radon is a naturally occurring, radioactive, colorless, odorless, tasteless gas produced from the decay of uranium and radium found in most soil and rock. Natural soils and rock such as granites, shales, and corals, contaminated soils from uranium processing mills, contaminated building materials, and groundwater water supplies directly from wells are a few common sources of radon. Radon can be found at some level in all indoor and outdoor air. Unlike most airborne contaminants radon is chemically inert, or chemically inactive. As a result, it is not chemically bound or attached to other materials and can move easily through porous materials or void space.

Typically, most radon gas is generated from the surrounding soil or bedrock, pulled through the soil or rock by air pressure differentials and enters the structure. However, radon gas can come from water, outside air, or contaminated building materials. The strength of the radon source has the biggest impact on indoor radon concentrations. The route of entry (i.e. through holes in the foundation), the building's ventilation rate, foundation type and differences in soils beneath the building can affect the indoor radon concentrations.

The primary health effect attributed to radon exposure is lung cancer. The World Health Organization (WHO), the National Academy of Sciences, the US Department of Health and Human Services, and the EPA classify radon as known human carcinogen. The EPA states radon is the largest source of radiation exposure and risk to the general public. When radon and products of radon decay are inhaled, decay can occur while in contact with the lung prior to being expelled. Because radon is chemically inert, most inhaled radon is rapidly exhaled. However, the inhaled decay products are readily deposited in the lungs, release energy in the form of radiation causing lung tissue damage and consequently increase the risk of lung cancer.

Radon concentrations in air are commonly expressed in picoCuries per liter (pCi/L) in the United States. An EPA national residential radon survey completed in 1991, determined the average indoor radon level is 1.3 pCi/L and the average outdoor level is about 0.4 pCi/L. The National Academy of Sciences' (NAS) latest report on radon, the Biological Effects of Ionizing Radiation (BEIR) VI Report (1999) estimates radon in indoor air causes about 21,000 lung cancer deaths each year in the United States. The EPA states that any level of radon carries some risk, there are no safe levels, and has established an action level of 4.0 pCi/L.

3.0 SCOPE OF WORK

Carnow, Conibear was contracted by East Aurora School District 131 to perform a radon survey at the Krug Elementary School located at 240 Melrose Avenue in Aurora, Illinois.

The scope of work included short-term radon measurements in frequently occupied rooms with substantial ground contact. The duration of short-term measurements can range from two (2) to four (4) days. Prior to placement of the radon measurement devices a Quality Assurance Project Plan (QAPP) was developed and general observations were performed to verify test conditions, identify device placement locations, and determine structural and mechanical building components. The QAPP was created to document and describe the necessary quality assurance procedures, quality control activities, and provide a clear, concise, and complete plan for the radon measurement operations. Observations of test conditions verified closed building conditions were maintained at a minimum of twelve (12) hours prior to testing and throughout the measurement period. Closed building conditions are necessary for short-term radon measurements in order to stabilize the radon and radon decay product concentrations and increase the reproducibility of the measurement. Closed building conditions require windows and exterior doors on all levels be kept closed (except for normal entry and exit) during the measurement period. Closed building conditions also require the normal operation of heating, ventilating, and air condition systems.

Radon test devices were deployed in forty-five (45) locations. In addition, four (4) duplicates, and three (3) blanks, were utilized to measure precision and bias, and ensure quality data. Radon test devices were documented in a permanent log noting the address of the building measured, a diagram of the test area noting the exact locations of all measurement devices deployed, exact start and stop times of the measurement period, a description of the device used and serial number, and the name and IEMA license number of the Radon Measurement Professional. At the end of the measurement period the radon test devices were retrieved, resealed, and mailed to the laboratory for analysis.

The radon measurement results are reported in picoCurie per liter. A picoCurie per liter is 2.22 atomic radon disintegrations per minute for each liter of air. The results of the radon measurements are interpreted to determine the need for additional testing and assess the quality and confidence of the measurement data. Typically, follow-up measurements will be recommended in every room with results greater than 4.0 pCi/L. The recommendation to mitigate elevated levels of radon shall not be based on the initial measurement results.

4.0 METHODOLOGY

The radon testing was performed following requirements set forth by the IEMA, USEPA, and Carnow Conibear's Quality Assurance Plan. The radon measurement survey consisted of several phases. The initial phase consisted of preliminary testing protocol, including an explanation of services, instructions to comply with closed building conditions, the development of the Quality Assurance Project Plan, and determination of the testing period. Next, general observations of the building were performed to verify test conditions, identify device placement locations, and determine structural and mechanical building components.

The measurement phase included the radon testing device placement and retrieval. Activated radon charcoal devices manufactured by Air Chek Inc. were utilized during this radon survey. The activated charcoal devices are passive devices containing activated carbon to measure radon. Radon test devices were placed in such a way to limit unintentional interference from building occupants. The measurement devices were placed at least three feet from doors, windows to the outside, at least one foot from exterior walls, at least four feet from heat sources, out of the direct flow of ventilation ducts and sunlight, and suspended in the general breathing zone. Duplicate tests were conducted for a minimum of 10% of the total radon test devices deployed to measure precision. Field blanks were submitted for a minimum of 5% of the total number of radon test devices deployed to measure background gamma radiation. Spike tests were not submitted for this survey, but are submitted for a minimum of three per 100 radon test devices or a minimum of three per year to measure laboratory accuracy. A total of fifty-two (52) radon test devices were deployed including forty-five (45) single devices, four (4) duplicates, and three (3) blanks. At the end of the measurement period the radon measurement devices were retrieved, resealed, and shipped overnight to Air Chek Inc. for analysis. Air Chek Inc. calculates the radon concentration after measuring the gamma activity by the radon decay products produced from the random decay of the collected radon. The final phase consisted of interpreting the results and an assessment of the quality and confidence of the measurement data.

5.0 SUMMARY OF RESULTS

Table 1.0 Radon Measurement Device Results identify all the radon measurement devices deployed and the reported radon results. The radon measurement results are reported in picoCurie per liter (pCi/L).

The radon measurement results indicate areas tested exceeded the EPA and IEMA recommended radon action level of 4.0 pCi/L during the time of the test. No testing abnormalities were noted during the radon measurement interval. Additionally, no radon mitigation systems were observed in the building.

Table 1.0 Radon Measurement Device Results

**Krug Elementary School -
240 Melrose Avenue
Aurora, Illinois 60505**

Device Location	Device Serial #	Start Date	Start Time	Stop Date	Stop Time	Result (pCi/L)	Comments
Room 1B	9042974	5/1/2018	3:07 PM	5/3/2018	6:05 PM	7.1	
Room 24/Nurse	9042975	5/1/2018	3:09 PM	5/3/2018	6:03 PM	5.5	
Room 25	9042976	5/1/2018	3:10 PM	5/3/2018	6:03 PM	6.0	
Room 25C	9042977	5/1/2018	3:12 PM	5/3/2018	6:04 PM	4.3	
Room 25B/Conference Room	9042978	5/1/2018	3:14 PM	5/3/2018	6:04 PM	7.0	
Room 25A	9042979	5/1/2018	3:15 PM	5/3/2018	6:04 PM	6.4	
Room 1	9042980	5/1/2018	3:19 PM	5/3/2018	6:13 PM	3.4	
Room 1	9042981	5/1/2018	3:19 PM	5/3/2018	6:13 PM	3.4	Duplicate RPD = 0.0%
Room 2	9042982	5/1/2018	3:12 PM	5/3/2018	6:12 PM	3.1	
Room 3	9042983	5/1/2018	3:23 PM	5/3/2018	6:11 PM	2.7	
Room 3A	9042984	5/1/2018	3:35 PM	5/3/2018	6:16 PM	7.3	
Room 4	9042985	5/1/2018	3:26 PM	5/3/2018	6:12 PM	3.0	
Room 5	9042986	5/1/2018	3:27 PM	5/3/2018	6:12 PM	3.4	
Room 6	9042987	5/1/2018	3:29 PM	5/3/2018	6:12 PM	3.8	
Room 7	9042988	5/1/2018	3:30 PM	5/3/2018	6:13 PM	3.9	
Room 7A	9042989	5/1/2018	3:32 PM	5/3/2018	6:29 PM	2.7	
Room 7B	9042990	5/1/2018	3:32 PM	5/3/2018	6:30 PM	2.6	
Room 8	9042991	5/1/2018	3:33 PM	5/3/2018	6:29 PM	2.8	
Room 9	9042992	5/1/2018	3:35 PM	5/3/2018	6:31 PM	2.5	
Room 10	9042993	5/1/2018	3:37 PM	5/3/2018	6:28 PM	1.8	

Table 1.0 Radon Measurement Device Results

**Krug Elementary School -
240 Melrose Avenue
Aurora, Illinois 60505**

Device Location	Device Serial #	Start Date	Start Time	Stop Date	Stop Time	Result (pCi/L)	Comments
Room 10A	9042994	5/1/2018	3:40 PM	5/3/2018	6:28 PM	2.1	
Room 10A	9042995	5/1/2018	3:40 PM	5/3/2018	6:28 PM	2.1	Duplicate RPD 0.0%
Room 10C	9042996	5/1/2018	3:42 PM	5/3/2018	6:39 PM	1.8	
Room 10C	9042997	5/1/2018	3:43 PM	5/3/2018	6:29 PM	2.5	
Room 10D	9042998	5/1/2018	3:44 PM	5/3/2018	6:29 PM	2.1	
Room 10B	9042999	5/1/2018	3:45 PM	5/3/2018	6:31 PM	1.9	
Room 13/Storage	9043000	5/1/2018	3:48 PM	5/3/2018	6:26 PM	2.9	
Room 11	9043201	5/1/2018	3:49 PM	5/3/2018	6:31 PM	2.1	
Room 12	9043202	5/1/2018	3:51 PM	5/3/2018	6:32 PM	3.4	
Room 14	9043203	5/1/2018	3:53 PM	5/3/2018	6:27 PM	2.6	
Room 14	9043204	5/1/2018	3:53 PM	5/3/2018	6:27 PM	2.0	Duplicate RPD 26.1%
Room 15	9043205	5/1/2018	3:55 PM	5/3/2018	6:28 PM	4.5	
Room 16	9043206	5/1/2018	3:57 PM	5/3/2018	6:40 PM	4.9	
Room 17	9043207	5/1/2018	3:58 PM	5/3/2018	6:40 PM	6.3	
Room 18	9043208	5/1/2018	4:00 PM	5/3/2018	6:41 PM	3.1	
Room 19	9043209	5/1/2018	4:01 PM	5/3/2018	6:41 PM	2.8	
Room 20	9043210	5/1/2018	4:03 PM	5/3/2018	6:40 PM	3.3	
Room 21	9043211	5/1/2018	4:04 PM	5/3/2018	6:40 PM	3.0	
Room 21A	9043212	5/1/2018	4:07 PM	5/3/2018	6:30 PM	2.8	
Room 21B	9043213	5/1/2018	4:09 PM	5/3/2018	6:46 PM	1.9	
Room 21D/Boiler	9043214	5/1/2018	4:10 PM	5/3/2018	6:47 PM	2.3	

Table 1.0 Radon Measurement Device Results

**Krug Elementary School -
240 Melrose Avenue
Aurora, Illinois 60505**

Device Location	Device Serial #	Start Date	Start Time	Stop Date	Stop Time	Result (pCi/L)	Comments
Room 21C	9043215	5/1/2018	4:13 PM	5/3/2018	6:47 PM	2.7	
Room 21C	9043216	5/1/2018	4:13 PM	5/3/2018	6:47 PM	2.9	Duplicate RPD 7.1%
Room 22	9043217	5/1/2018	4:15 PM	5/3/2018	6:48 PM	2.7	
Gym	9043218	5/1/2018	4:17 PM	5/3/2018	6:47 PM	2.1	
Gym	9043219	5/1/2018	4:18 PM	5/3/2018	6:47 PM	2.6	
Room 23A	9043220	5/1/2018	4:20 PM	5/3/2018	6:48 PM	2.7	
Room 23A	9043221	5/1/2018	4:22 PM	5/3/2018	6:48 PM	2.9	
Room 23E	9043222	5/1/2018	4:24 PM	5/3/2018	6:46 PM	3.1	
Hallway	9043223	5/1/2018	4:30 PM	5/3/2018	6:49 PM	< 0.3	Blank
Hallway	9043234	5/1/2018	4:30 PM	5/3/2018	6:49 PM	< 0.3	Blank
Hallway	9043225	5/1/2018	4:30 PM	5/3/2018	6:49 PM	< 0.3	Blank

RPD - Relative Percent Difference = difference divided by the average of simultaneous results times 100. Results less than 4.0 pCi/L shall agree with a RPD of less than 67 percent. Results greater than 4.0 pCi/l shall agree with a RDP of less than 36 percent.

The EPA and IEMA recommended radon action level is 4.0 pCi/L.

Bold – indicated result exceeded radon action level.

6.0 CONCLUSIONS

Carnow, Conibear, & Assoc., Ltd. (Carnow Conibear) was contracted by East Aurora School District 131 to perform a radon survey at the Krug Elementary School located at in Aurora, Illinois. The survey was initiated on May 1, 2018 and completed on May 3, 2018 by Nicole Bennett, an Illinois Emergency Management Agency (IEMA) licensed Radon Measurement Professional (License No. RNI2016213). The scope of work included short-term (two to four day) radon measurements in frequently occupied rooms with substantial ground contact. The radon survey was performed in following the IEMA and the USEPA testing protocols for commercial and school radon measurements, the radon device manufacturer's recommendations, and the Carnow Conibear Quality Assurance Plan.

Radon measurement results ranged from 1.8 to 7.3 pCi/L. The radon measurement results indicate areas tested exceeded the EPA and IEMA recommended action level of 4.0 pCi/L during the time of the test. The average indoor radon concentrations are 1.3 pCi/L nationwide. The average outdoor radon concentration is 0.4 pCi/L.

Based on the radon measurement results Carnow Conibear recommends the following:

- Follow-up radon testing in locations exceeding the EPA recommended radon action level of 4.0 pCi/L. Per IEMA, a recommendation to mitigate elevated levels of radon shall not be based on initial measurement results. Follow-up radon testing is also recommended in locations with invalid test results.
- Routine follow-up radon measurement surveys every two (2) years at different seasonal times following IEMA and the USEPA testing protocols and the radon device manufacturer's recommendations.
- Additional testing if significant changes are made to the building's structural or mechanical components.


7.0 LIMITATIONS AND CONDITIONS

The information contained in this report was prepared for the exclusive use and reliance of East Aurora School District 131 and Carnow Conibear. This information is based on the specific parameters of the scope of work for this project and the regulations in force at the time of the report.

Carnow Conibear has applied prevailing industry standards and reasonable judgment and effort within the scope of work, while conducting the radon measurement survey. The standards, judgment, and effort used by Carnow Conibear personnel to investigate, assess, and determine the presence of potential environmental hazards and liabilities associated with the radon survey at the Krug Elementary School, Aurora, Illinois are consistent with requirements outlined in federal and state guidelines. Carnow Conibear makes no warranty, express or implied, that the findings and interpretations in this report are a complete representation of the environmental hazards and liabilities, associated with the Krug Elementary School, Aurora, Illinois.

APPENDIX A

Floor Plans – Radon Sampling Locations

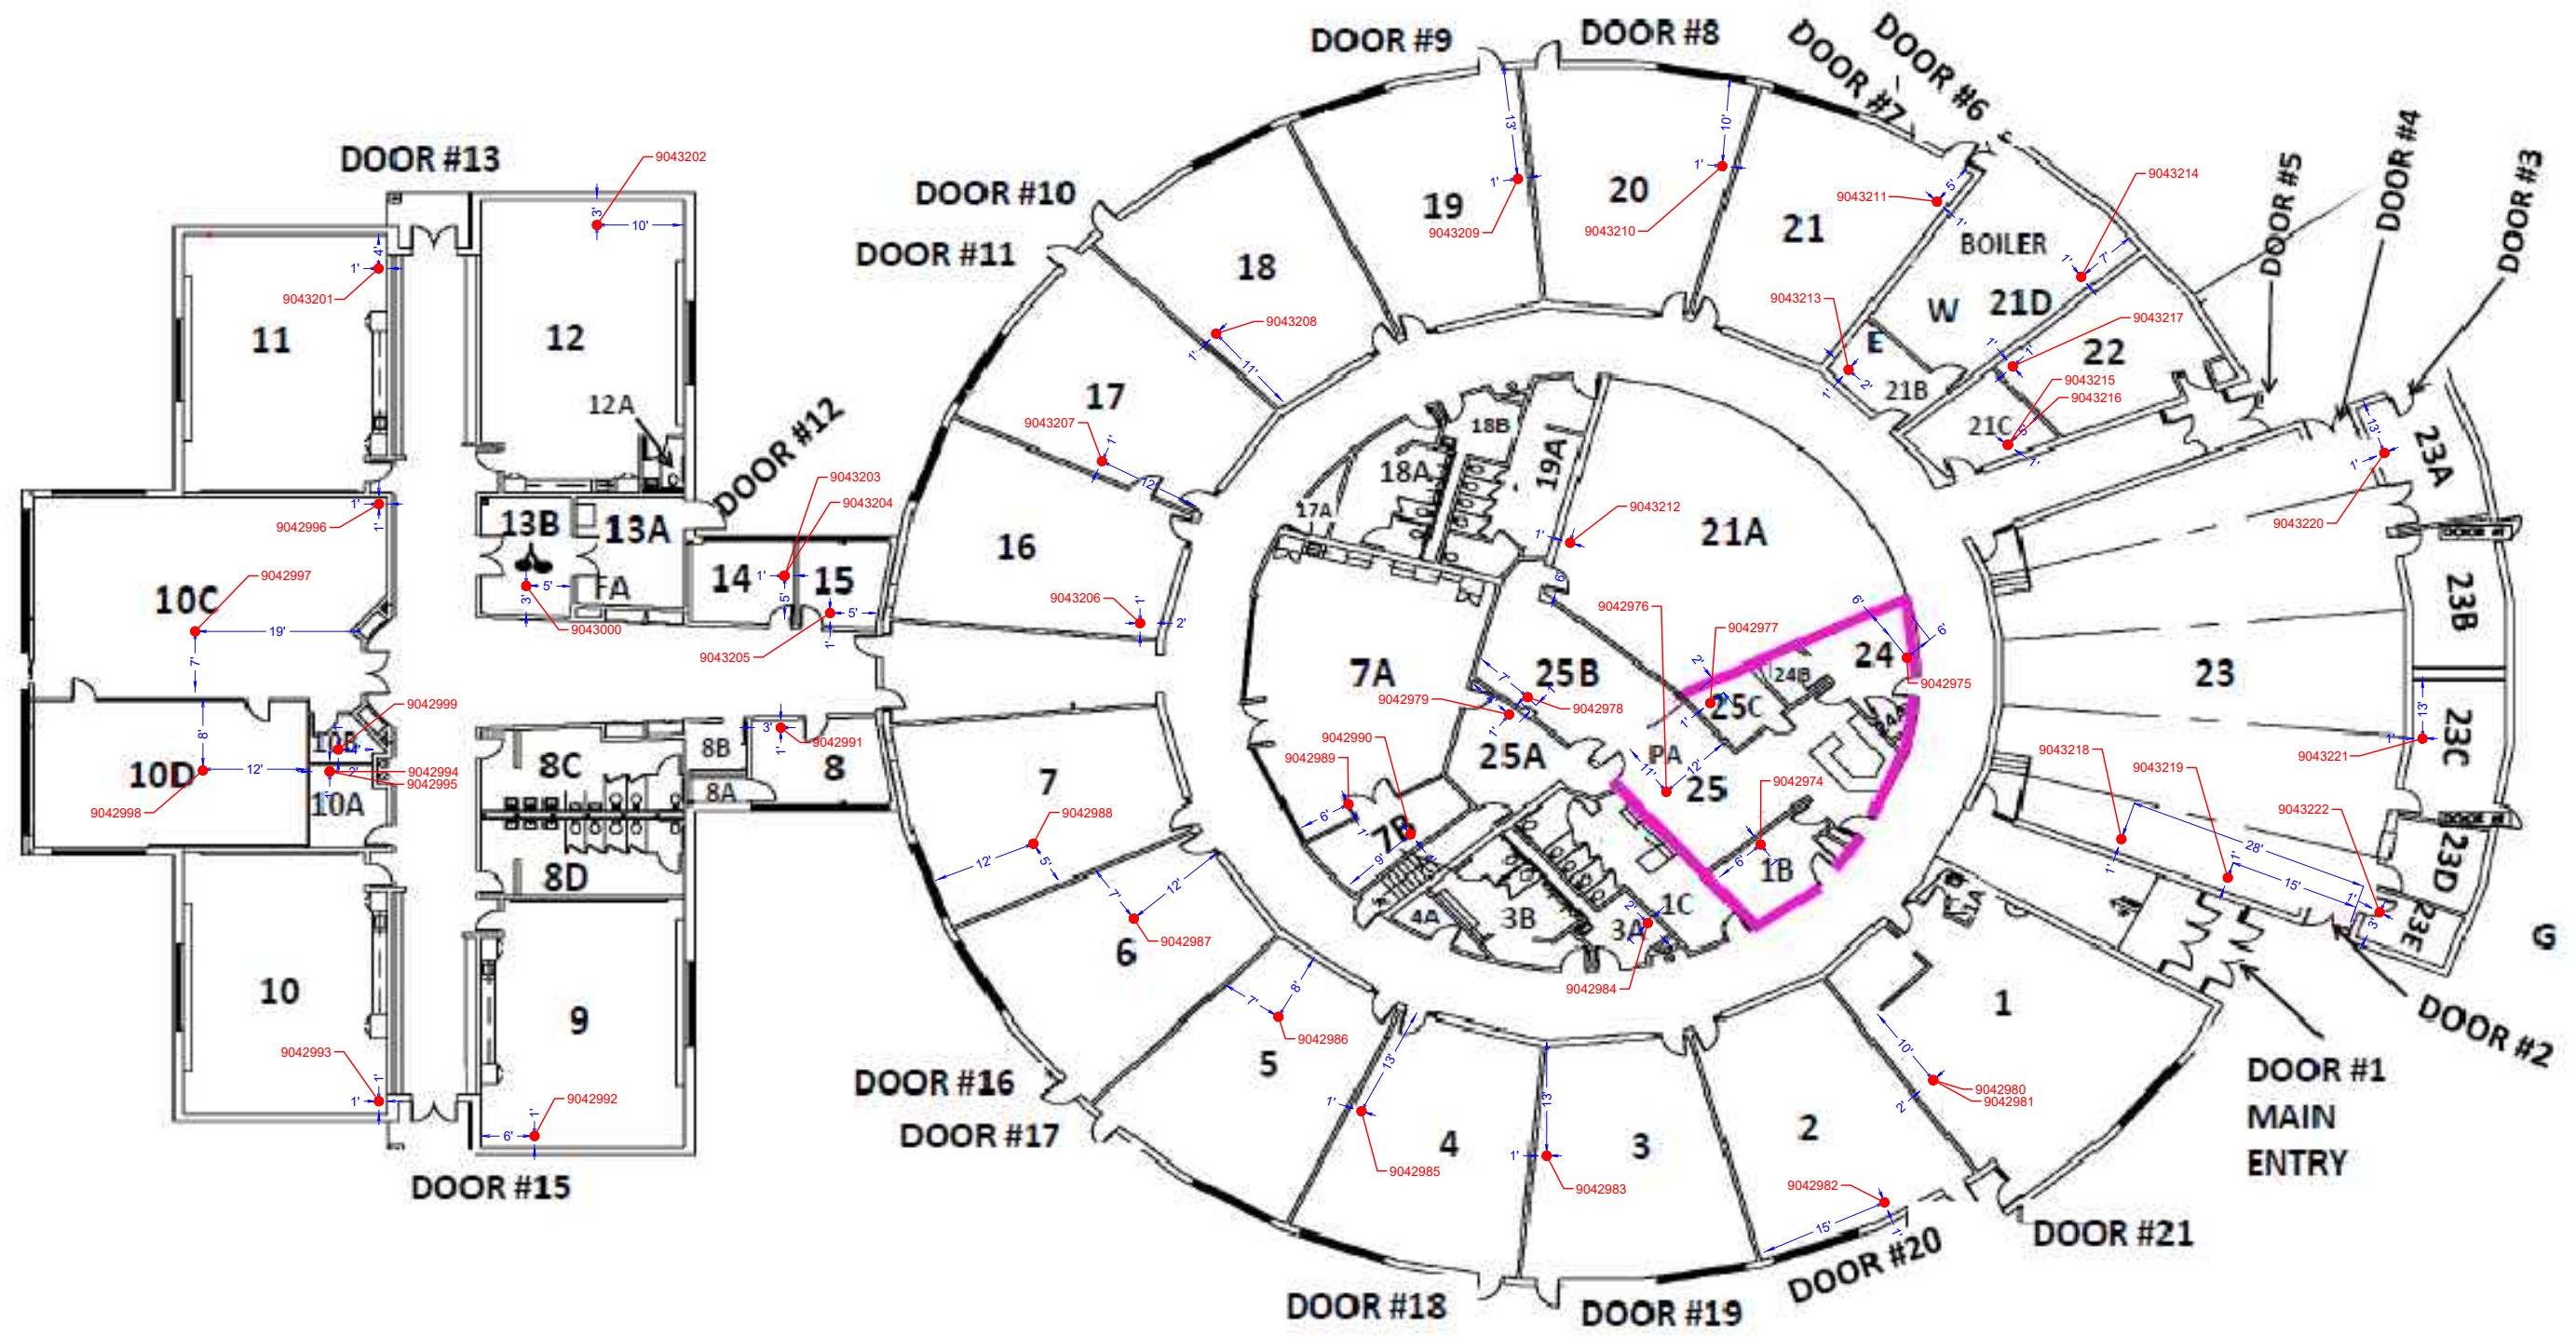

1 RADON SAMPLE LOCATIONS
GROUND FLOOR PLAN

NOT TO SCALE

LEGEND:

- Approximate location of activated charcoal radon measurement device
- 4482418 Radon measurement device serial number

SHEET TITLE:

Radon Testing Locations at
Krug Elementary School
240 Melrose Avenue
Aurora, Illinois 60505

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaltd.com

CCA PROJECT NO.
A146000137

SURVEY DATE:
4/30/2018 to 5/3/2018

SHEET NO.



Rn-1

TESTED BY:
Derek Lantry
IEMA License #: RNI2004213

DRAWN BY:
J. Kalingsan

CHECKED BY:
D. Lantry

CLIENT:

East Aurora Public School District 131
417 Fifth Street
Aurora, Illinois, 60505

K:_comppd\Projects\Radon Program\2018 Projects\2018 East Aurora District Radon Testing\Krug\Krug School Radon.dwg

APPENDIX B

Laboratory Analysis Report

Radon test result report for:**SCHOOL****KRUG ELEMENTARY**

Kit #	Room Id	Started	Ended	pCi/L	Analyzed
9043219	GYM	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.6 ± 0.5	2018-05-08
9043218	GYM	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.1 ± 0.4	2018-05-08
9043234	HALLWAY	2018-05-01 @ 5:00 pm	2018-05-03 @ 7:00 pm	< 0.3	2018-05-08
9043223	HALLWAY	2018-05-01 @ 5:00 pm	2018-05-03 @ 7:00 pm	< 0.3	2018-05-08
9043225	HALLWAY	2018-05-01 @ 5:00 pm	2018-05-03 @ 7:00 pm	< 0.3	2018-05-08
9042980	ROOM 1	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	3.4 ± 0.5	2018-05-08
9042981	ROOM 1	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	3.4 ± 0.5	2018-05-08
9042993	ROOM 10	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	1.8 ± 0.4	2018-05-08
9042994	ROOM 10A	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	2.1 ± 0.4	2018-05-08
9042995	ROOM 10A	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	2.1 ± 0.4	2018-05-08
9042999	ROOM 10B	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	1.9 ± 0.4	2018-05-08
9042996	ROOM 10C	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	1.8 ± 0.4	2018-05-08
9042997	ROOM 10C	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	2.5 ± 0.5	2018-05-08
9042998	ROOM 10D	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	2.1 ± 0.4	2018-05-08
9043201	ROOM 11	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.1 ± 0.4	2018-05-08
9043202	ROOM 12	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	3.4 ± 0.5	2018-05-08
9043000	ROOM 13/STORAGE	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	2.9 ± 0.5	2018-05-08
9043203	ROOM 14	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	2.6 ± 0.5	2018-05-08
9043204	ROOM 14	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	2.0 ± 0.4	2018-05-08
9043205	ROOM 15	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	4.5 ± 0.5	2018-05-08
9043206	ROOM 16	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	4.9 ± 0.5	2018-05-08
9043207	ROOM 17	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	6.3 ± 0.6	2018-05-08
9043208	ROOM 18	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	3.1 ± 0.5	2018-05-08
9043209	ROOM 19	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.8 ± 0.5	2018-05-08
9042974	ROOM 1B	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	7.1 ± 0.6	2018-05-08
9042982	ROOM 2	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	3.1 ± 0.5	2018-05-08
9043210	ROOM 20	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	3.3 ± 0.5	2018-05-08
9043211	ROOM 21	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	3.0 ± 0.5	2018-05-08
9043212	ROOM 21A	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.8 ± 0.5	2018-05-08
9043213	ROOM 21B	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	1.9 ± 0.4	2018-05-08
9043215	ROOM 21C	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.7 ± 0.4	2018-05-08
9043216	ROOM 21C	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.9 ± 0.4	2018-05-08
9043214	ROOM 21D/BOLIER	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.3 ± 0.4	2018-05-08
9043217	ROOM 22	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.7 ± 0.4	2018-05-08
9043220	ROOM 23A	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.7 ± 0.4	2018-05-08
9043221	ROOM 23A	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.9 ± 0.5	2018-05-08
9043222	ROOM 23E	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	3.1 ± 0.4	2018-05-08

May 10, 2018

**** LABORATORY ANALYSIS REPORT ****

Radon test result report for:

**SCHOOL
KRUG ELEMENTARY**

Kit #	Room Id	Started	Ended	pCi/L	Analyzed
9042975	ROOM 24/NURSE	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	5.5 ± 0.6	2018-05-08
9042976	ROOM 25	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	6.0 ± 0.6	2018-05-08
9042979	ROOM 25A	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	6.4 ± 0.6	2018-05-08
9042978	ROOM 25B/CONFERENCE ROOM	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	7.0 ± 0.6	2018-05-08
9042977	ROOM 25C	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	4.3 ± 0.5	2018-05-08
9042983	ROOM 3	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	2.7 ± 0.4	2018-05-08
9042984	ROOM 3A	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	7.3 ± 0.6	2018-05-08
9042985	ROOM 4	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	3.0 ± 0.5	2018-05-08
9042986	ROOM 5	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	3.4 ± 0.5	2018-05-08
9042987	ROOM 6	2018-05-01 @ 3:00 pm	2018-05-03 @ 6:00 pm	3.8 ± 0.5	2018-05-08
9042988	ROOM 7	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	3.9 ± 0.5	2018-05-08
9042989	ROOM 7A	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	2.7 ± 0.5	2018-05-08
9042990	ROOM 7B	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.6 ± 0.4	2018-05-08
9042991	ROOM 8	2018-05-01 @ 4:00 pm	2018-05-03 @ 6:00 pm	2.8 ± 0.4	2018-05-08
9042992	ROOM 9	2018-05-01 @ 4:00 pm	2018-05-03 @ 7:00 pm	2.5 ± 0.4	2018-05-08

APPENDIX C

Radon Measurement Professional License

Bruce Rauner
Governor

State of Illinois
IEMA Division of Nuclear Safety

James K. Joseph
Director

Pursuant to the Radon Industry Licensing Act, 420 ILCS 44 et seq. and 32 Illinois Administrative Code 422, Licensing of Radon Detection and Mitigation Services, and in reliance on statements and representations heretofore made by the licensee, a license is hereby issued.

This is to certify that **Nicole Bennett**

License Number **RNI2016213**

has met the requirements for **Radon Measurement Professional**

Issued - Expires **05/18/2016 - 05/31/2021**

Limited to **Radon measurements of residential real estate, home environment, school and commercial buildings only.**



161391001

Patrick I. Daniels

Patrick I. Daniels, Radon Program